PowerStation RS Monitor Mounting Cover

Installation Instructions

These instructions explain how to fasten the Monitor Mounting Cover onto the PowerStation RS Monitor. Attaching the cover to the monitor will enable you to mount the monitor on an adjustable mounting arm, while still providing easy access to the monitor's power switch and on-screen display (OSD) controls. The cover is shipped with the screws that you will need to fasten the cover to the monitor.


Note The Monitor Mounting Cover supports a 100mm VESA standard mounting pattern.

The dimensions of the Monitor Mounting Cover are shown below.

Monitor Size	Mounting Cover Dimensions (H x W x D)
12.1"	12.1" (307.34mm) x 15.1" (383.54mm) x 3.3" (83.82mm)
15.1"	13.3" (337.82mm) x 16.8" (426.72mm) x 3.5" (88.90mm)

To install the Monitor Mounting Cover on the monitor, complete the following steps:

- 1. Make sure that the monitor's Power switch is off (in the "down" position).
- 2. Attach the following cables to the monitor. The connections are shown in the illustration below. Be sure to screw each cable securely into its connector.

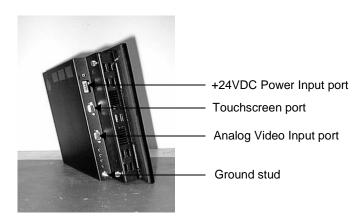

CTC Parker Automation A3-05781-101

• Connect the power cord to the Power Input port.

Important In order to obtain Underwriters Laboratories approval for your monitor installation, a PowerStation RS Monitor with Mounting Cover must use a limited energy power source, such as CTC's External AC Power Supply Adapter (P1X-PWRAC).

- If you have a touchscreen monitor, connect the 9-pin touchscreen cable to the Touchscreen port.
- Connect the 15-pin video cable to the Analog Video Input port.
- 3. Connect the ground stud at the lower left side of the monitor to an effective, known earth ground.
- 4. Slide the Monitor Mounting Cover onto the back of the monitor as shown below. The vents on the cover should be at the top of the monitor back.



5. Fasten the cover to the monitor with the 7 retaining screws included in the installation kit. Three screws will fasten across the top of the cover and two on each side, as shown in the illustration on the next page.

2 CTC Parker Automation



Holes for retaining screws

Your PowerStation RS Monitor is now ready to be mounted on an adjustable arm. For instructions on how to accomplish this, see the mounting instructions that accompany the arm.

Important To ensure that your RS Monitor remains securely fastened to its adjustable arm, attach it to the arm using the four $8-32 \times 1/4$ " screws shipped with the Monitor Mounting Cover.

CTC Parker Automation 3